

# **IHH500**

Intelligent Handheld Display

**Sensor Solutions Source** 

Load · Torque · Pressure · Multi Component · Calibration · Instruments · Software

www.futek.com

### **Getting Help**

#### **TECHNICAL SUPPORT**

For more IHH500 support, please visit: http://www.futek.com/ihh500/support.aspx



Drawing Number: SP1189

FUTEK reserves the right to modify its design and specifications without notice. Please visit http://www.futek.com/salesterms for complete terms and conditions.

10 Thomas, Irvine, CA 92618 USA

Tel: (949) 465-0900 Fax: (949) 465-0905

www.futek.com

### **Table of Contents**

Display Features
Buttons
Connector Pin Configuration
Wiring Layout
Profile Quick Setup (Calibration)
TEDS and Channel Select
Profile Lockout and LCD Settings
Analog Output Quick Setup

Alarm and Relay Quick Setup
Data Logging
SENSIT Test and Measurement Software
Performance Review
Specifications
Setting Sampling rate and number of digits
Troubleshooting

### **Display Features**

- 1 Power Connector
- 2 USB Connector (Compatible with USB 2.0 Only)
- 3 Output Connector
- 4 Sensor Connector
- 5 16×4 Character LCD
- 6 Active Channel Number
- 7 Peak Value
- 8 Tracking

- 9 Valley Value
- 10) Sampling Rate
- 11) Battery Indicator
- Larger Font
  Display Options
- 13) Peak/Valley Reset
- Shunt Calibration
  Verification
- 15 Power Key



#### **Buttons**



Displays Battery Life
IN MENU MODE: Enter



Toggles between engineering units (force, torque, pressure and displacement) and the standard mV/V.

IN MENU MODE: ▶ Arrow



Toggles between displaying the tare and gross values. Used to remove any fixture weights.

IN MENU MODE: ▲ Arrow



Alters the current reading by shunting a resistor across the – Excitation and – Signal connections

IN MENU MODE: Exit



Toggles between two font sizes. Selects one of four states in normal mode, and one of five states (RPM, torque, angle, power) when a rotary sensor with encoder is monitored.

IN MENU MODE: Back



Freezes the current reading. HOLD will appear on the LCD when active. Pressing any key on the keypad will cancel the hold command.

IN MENU MODE: ▼ Arrow

IN MENO MODE: V AITO



Resets peak/valley or angle (in rotary sensors with an encoder)

IN MENU MODE: ▲ Arrow



ON/OFF
IN MENU MODE: ON/OFF



Start navigation IN MENU MODE: n/a

## **Connector Pin Configuration**



### Wiring Layout

POWI	ER CONNECTIONS			
PIN	SYMBOL			
1	12V			
2	Ground			
Note: These pins are not polarity sensitive.  USB PORT CONNECTIONS				
		-		
	PORT CONNECTIONS PATIBLE WITH USB 2.0 ONLY) SYMBOL	-		
(COM	PATIBLE WITH USB 2.0 ONLY)	-		
PIN	PATIBLE WITH USB 2.0 ONLY)  SYMBOL	-   -   -		
PIN 1	SYMBOL VBUS	-   -		

OUTPUT CONNECTIONS			
PIN	SYMBOL	DESCRIPTION	
1	IDAC	analog current output signal	
2	REFERENCE	analog voltage output return	
3	+R1	solid state relay 1 (positive)	
4	VDAC	analog voltage output signal	
5	+R2	solid state relay 2 (positive)	
6	GND	analog current output return	
7	-R1	solid state relay 1 (negative)	
8	-R2	solid state relay 2 (negative)	



IHH500 Wiring Connection Examples: http://www.futek.com/files/Pdf/Manuals\_and\_Technical\_Documents/IHH500Wiring.pdf

### Wiring Layout (continued)

SENSOR CONNECTIONS			
PIN	SYMBOL	DESCRIPTION	
Α	+E	+Excitation	
В	+S	+Signal	
С	–E	-Excitation, TEDS return	
D	-S	–Signal	
Е	TEDS_IO	TEDS Data	
F	24_OUT	24V output	

PIN	SYMBOL	DESCRIPTION
G	GND_OUT	Ground/Shield
Н	5_OUT	5V Output
J	-V	–V and –mA Amplified Input Connections
K	+V	+V and +mA Amplified Input Connections
L	PLEAD	Leading pulse from sensor
М	PLAG	Lagging pulse from sensor

**Note:** Cable should be connected to pin G, ground, and should be grounded on one end, either the sensor side or the IHH500 connection side.

#### 12-PIN SENSOR TO IHH500 BINDER ASSEMBLY



#### **CONNECTION TIPS**

The +/- Excitation and +/- Signal connections are used with mV/V output sensors with the +/- Excitation used to supply power to the sensor.

The 24V output supply can be used to power amplified sensors such as our amplified Rotary Torque sensors, for example TRS605.

The 5V output is typically used to power items such as the encoder in our rotary toque sensors.

The IHH500 Elite is callable of interacting with encoders, such as those in our Rotary Toque sensor, with the encoder outputs on the Leading and Lagging pulse connections.

Typically our rotary torque sensor encoders will have Angle 1 on the Leading Pulse connection and Angle 2 on the Lagging pulse connections. If the Leading Pulse Pin L leads Pin M the Encoder count will increase and if the Lagging Pin M leads Pin L the encoder count will decrease.

Find FUTEK's wiring codes at <a href="http://www.futek.com/wirecode.aspx">http://www.futek.com/wirecode.aspx</a>

### **Profile Quick Setup (Calibration)**

The IHH500 can store up to 15 profiles with channel 2 through 15 being user selectable.

- 1. Menu
- 2. Sensor Profile
- New Channel
- 4. Set channel using left and right arrow keys followed by Enter
- 5. Sensor Config and choose sensor output type
- 6. Direction
- 7. Unit Selection

- 8. Sensor Capacity
- 9. Sensitivity (+)
- 10. Sensitivity (-) if applicable
- 11. Serial Number, (Serial number on sensor)
- 12. Back to go back one menu
- 13. Save Changes
- 14. Back to exit Main Menu and put the IHH500 into normal reading display



A full profile setup guide can be found on our FUTEK website at: http://www.futek.com/files/Pdf/QuickStartGuide/IHH500ProfileSetup.pdf

#### TIPS FOR SETTING UP A PROFILE

The decimal point can be moved by selecting it first and turning it into a number, and then selecting another digit to change it into a decimal point.

Sensitivity (+) must be entered. If only one direction is selected, then sensitivity (+) will be applied to both directions of output or negative direction output.

Sensitivity is the sensor's output level, such as mV/V output, and is found on the calibration certificate.

Online sensor calibration data may be available by sensor serial number at http://www.futek.com/calibrationData.aspx to assist in finding your sensor's output or sensitivity.

Pressing back without saving will prompt to exit without saving. Enter can be used for Yes, and Back for No.

IHH500 Elite supports Encoders through Pulse profiles.

Current profiles cannot be set up manually and must be set up using the Live Calibration feature in the profile setup.

Full bridge sensor type is for mV/V output sensors. Voltage output and current output are for amplified inputs to the IHH500.

#### **TEDS and Channel Select**

#### **TEDS MENU**

- 1. Menu
- 2. TEDS Data
- 3. TEDS Device Will show information about TEDS chip.
- TEDS Pages Shows programmed information stored in chip.
- 5. Load Data Will load TEDS information into IHH500.
- Auto Detection Sets the IHH500 to automatically load TEDS information upon power on.

#### CHANNEL SELECT (CALIBRATION PROFILE SELECT)

- 1. Menu
- 2. System Setting
- 3. Channel Select
- 4. Use the left and right arrow key to choose the desired channel.
- 5. Enter to load Channel or Profile.

# TIPS FOR USING TEDS AND CHANNEL SELECT

TEDS is a small chip that can store a sensor's calibration information. The IHH500 can read it upon power up, or by loading it through the menu, and setup a profile with the stored information.

TEDS calibration information can be viewed upon loading TEDS, either during a power on or while selecting Load Data under the TEDS menu.

The TEDS chip should be placed within 5ft. of the IHH500 sensor connection to maintain proper power. Typically the TEDS chip is placed in the sensor binder connector.

An auto-calibration may be performed when loading TEDS information, or a new channel or profile.

### **Profile Lockout and LCD Settings**

#### LOCK SETTING MENU

- 1. Menu
- 2. Lock Setting
  - a. Lockout Profile
  - b. Unlock Profile
  - c. Change Password

#### LCD SETTINGS

- 1. Menu
- 2. LCD Setting
  - a. Contrast
  - b. Brightness
  - c. Auto LCD Off



#### TIPS FOR PROFILE LOCKOUT & LCD SETTINGS

To lockout the ability to create, edit, or delete a calibration profile in the IHH500, use the Lock Settings menu.

The default lockout password will be the serial number on the back of the IHH500. The password can be changed to a new numerical combination

The LCD contrast and brightness can be set to maximum and the levels can be saved as default for all future usage of the IHH500.

Use the left and right arrow keys to increase or decrease the brightness and contrast of the LCD display in the LCD display setup menu.

A message stating, "Selected feature is not available at this time," will be displayed when profile control is locked out.

Profile will be locked out when a system calibration at FUTEK is performed.

13

### **Analog Output Quick Setup**

#### VOLTAGE OUTPUT

#### **Output Type Setup:**

- 1. Menu
- 2. Output Config.
- 3. Voltage Config.
- 4. Select Bi-polar or Uni-polar

#### Turn on voltage output:

- 5. Back to exit to main menu
- 6. Interfaces
- 7. Voltage Output
- 8. Select Enable
- 9. Back to main menu
- 10. Back again to exit

#### **CURRENT OUTPUT**

#### **Output Type Setup:**

- 1. Menu
- 2. Output Config.
- Current Value
- 4. Select current output range
- 5. Current Config.
- 6. Select Uni-direction or Bi-direction

#### Turn on current output:

- 7. Back to exit to main menu
- Interfaces
- 9. Current Output
- 10. Select Enable
- 11. Back to exit to main menu

#### **TIPS FOR ANALOG OUTPUT**

Bi-polar and Uni-polar for voltage configurations will determine if the output would be ±5VDC for both directional outputs from the sensor, or map both directional outputs to +5VDC with the zero at 2.5VDC.

Analog Low is set to zero load readings and Analog High is set to the full capacity of the sensor profile.

Uni-direction or Bi-direction for current will determine if the current output range is for the positive output of the sensor, or if the zero should be shifted to allow the selected current output range to adjust for both directions from the sensor.

A Tare function will affect the reading on the IHH500 as well as the Analog Output.

### Alarm and Relay Quick Setup

#### **ALARM SETUP**

#### Alarm Limit set points:

- 1. Menu
- 2. Sensor Profile
- 3. Edit Channel (Choose appropriate channel)
- 4. Limit & THD
- Alarm Limit Hi and Alarm Limit Lo (Set the appropriate percentage of the full sensor's output for Hi and Lo limits)
- 6. Back to Edit Profile Menu
- 7. Back to Profile Menu
- 8. Save Changes
- 9. Back to Main Menu
- 10. Back to Display Screen

#### Alarm Configuration and Alarm Activity:

- 11. Menu
- 12. System Settings
- 13. Alarm Config (Latched or Non-Latched)
- 14. Alarm Activity (Enable or Disable)
- 15. Back to Main Menu
- 16. Back to Display Screen

#### **TIPS FOR ALARMS AND RELAYS**

Alarms function off GROSS readings.

### Alarm and Relay Quick Setup (continued)

#### **RELAY SETUP**

#### Output configuration:

- 1. Menu
- 2. Output Config.
- 3. Alarm Relay 1 and Alarm Relay 2
- 4. Choose Normally Open or Normally Closed
- 5. Back to Output Config. Menu
- 6. Back to Main Menu
- 7. Back to Display Screen

#### **Activate Relays:**

- 8. Menu
- 9. Interfaces
- 10. Relay 1 and Relay 2 Output (Enable or Disable)
- 11. Back to Main Menu
- 12. Back to Display Screen

#### TIPS FOR ALARMS AND RELAYS

Alarm Relay 1 is mapped to Alarm High and Alarm Relay 2 is mapped to Alarm Low.

Threshold limits are set as a percentage of the capacity of the sensor.

Pressing Reset on the IHH500 will reset any alarm status.

Peak will flash on the IHH500 for an active alarm high state, and Valley will flash for an active low alarm state.

### **Data Logging**

Data logging is the ability to capture readings over a specified time period for later evaluation. The Data logging information can be uploaded into the FUTEK SENSIT software and further exported into other programs, such as Microsoft Excel.

#### DATA LOGGING QUICK SETUP

- 1. Menu
- 2. Data Logging
- 3. Logging Rate
- 4. Choose Full speed or Half Speed
- 5. Duration
- 6. Enter duration of data logging test in seconds
- 7. Action
- 8. Choose to Start or Stop data logging session

#### TIPS FOR USING DATA LOGGING

The IHH500 can store up to 21,000 data logging points. Each point is a captured reading.

The sampling rate used will be the current sample per second setting in the IHH500 when Full Speed is selected and half the current set sampling rate when Half Speed is selected.

The maximum data logging duration will be the 21,000 data logging points divided by the sampling rate used.

The data logging information is lost when power is turned off on the IHH500.

At slower sampling it is possible to exit the data logging menu to view a countdown timer.

A check mark will be present next to Action to show a data logging session is active. When the data logging session is complete the IHH500 will display a successful message and return to the display screen.

Pressing stop before the end of a session will result in the captured readings overwriting the prior readings up till the run time.

#### SENSIT<sup>™</sup> Test and Measurement Software

The IHH500 can be used with the FUTEK SENSIT software, which can be purchased separately or evaluated through a free trial version available on the FUTEK website.

# FUNCTIONS AVAILABLE IN SENSIT WITH THE IHH500:

- Ability to see current reading in Display table
- Ability to upload, list, plot, and export data logging information from the IHH500
- Ability to view, list, and export a live graphing session
- Ability to remotely control the IHH500 through a virtual front panel

#### TO SETUP DATA LOGGING IN SENSIT FOR IHH500:

- 1. Data Logging Mode Tab
- 2. Settings
- 3. File Path
- Start Test

In SENSIT the items that do not apply to the IHH500 will be grayed out in the Data logging Settings.

Start Test will import the data logging information into SENSIT.

#### TIPS FOR USING SENSIT WITH THE IHH500

The IHH500 should be turned on and connected to the computer prior to starting SENSIT.

USB output, under Interfaces in the IHH500, should be enabled with a check mark to confirm its operation.

### **Performance Review**

INPUT			
PARAMETER	MIN	MAX	UNIT
Input Range 1	-500	500	mV/V nom.
Input Range 2	-12	12	VDC
Input Range 3	0	30	mA

POWER ADAPTER			
MIN	MAX		
90-264 VAC	0.5 A 50/60 Hz		
12 VDC	1A		
	MIN 90–264 VAC		

OUTPUT			
PARAMETER	MIN	MAX	UNIT
Analog Voltage	0	5	VDC
	<b>-</b> 5	5	VDC
Analog Current	0	20	mA
	4	20	mA
	0	25	mA
	5	25	mA

### **Specifications**

#### POWER REQUIREMENT

• Power Supply Adapter: 12 VDC/1 A

• Internal battery: Rechargeable, lithium polymer battery

Battery size: 7.4V/3000 mAh

• Run Time: up to 30 hours with  $350\Omega$  Bridge

• Battery Charger: Wall plug AC powered-unit

#### **SOLID STATE RELAYS**

• Part Number: G3VM-2F

• Application: Alarm Relay 1, 2

• Maximum Output Voltage: 250V (AC or DC)

Maximum Output Current: 120 mA

Note: Internally limited and protected to 110V/100 mA

#### **PASSWORDS**

• Default Password: 0000000

Alternative Password: Device's Serial Number

#### RESPONSE TIMES

Conversion capture rate: every sample

Peak capture rate: every sample

Valley capture rate: every sample

Conversion display update rate: 5 times per second

Peak display update rate: 5 times per second

Valley display update rate: 5 times per second

#### **BANDWIDTH**

The digital output bandwidth has been specified as SPS/4.

The analog output bandwidth has been specified as SPS/4 for sampling rates less than 1200 SPS and has been specified as SPS/5 for sampling rates more than 1200 SPS if:

- 1. ASCII stream output is deactivated
- 2. IHH500 is not connected to computer
- 3. All relays are disabled
- 4. Display is in menu mode (Peak, Valley, Tracking, and data display are main display mode)

### Sampling Rate and Selecting number of Digits

#### SETTING SAMPLING RATE

- 1. Menu
- 2. System Settings
- 3. Sampling Rate

#### CHANGING NUMBER OF DIGITS:

- 1. Menu
- 2. System Settings
- 3. Digits Select

#### **TIPS**

The sampling rate can be set from 5 sps to 4800 sps at preset intervals.

Increasing the sampling rate may increase the noise as the IHH500 becomes more sensitive to input changes.

The decimal point is floating on the IHH500 which means with 4 decimal points the format will automatically adjust from 0000 to 0.000. For example, a 1,000lb load cell would display from 1000 to 0.001lbs.

The number of digits can be selected from 3 to 6 and can be saved as default.

### **Troubleshooting Tips**

- An "Overflow" message usually indicates an output higher than that specified in the profile type and can be from the load cell or from an open to the IHH500 from the sensor. The load cell connections should be confirmed and the load cell for any overload damage.
- If the sensor profile is locked out a message, "Selected feature is no available at this time," will appear. See the lock setting section of this manual for more information.
- A live calibration can be performed using the calibration option in the IHH500 profie setup and will require known loads. The load to use should match the capacity listed in the profile.
- If the readings are not correct for the applied load, review the sensor profile and confirm the capacity and sensitivity for your load cell.

- Profile 1 is a system mV/V reference channel and can be used to confirm the output of a sensor and help in troubleshooting any questions in a profile setup.
- In the main menu Diagnostic can be used with the external setting to confirm the resistance on the output connections of the load cell.
- In the IHH500 Elite the Display button can be pressed to show encoder information. This screen must be active for SENSIT Live Graphing to capture encoder information.

10 Thomas, Irvine, CA 92618 USA

Tel: (949) 465-0900 Fax: (949) 465-0905

www.futek.com